

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start		Rating **	A	Issue No.	16
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Operations & Maintenance Manuals			°	°
				°	°
DWR ID	DWR_LD0003_01_s_2013_16				
Comment Code					
Inspector Comment					
The LMA has the O&M manuals.					

No Photos

LM Start		Rating **	A	Issue No.	17
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Emergency Supplies & Equipment			°	°
				°	°
DWR ID	DWR_LD0003_01_s_2013_17				
Comment Code					
Inspector Comment					
The LMA has adequate flood fight supplies and equipment.					

No Photos

LM Start		Rating **	M	Issue No.	18
LM End		Issue Type +	Ma	Location *	
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Flood Preparedness & Training			°	°
				°	°
DWR ID	DWR_LD0003_01_s_2013_18				
Comment Code					
Inspector Comment					
The LMA has not completed flood fight training in the past 10 years.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	0.01	Rating **	M	Issue No.	53
LM End	1.22	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Vegetation		39.384049 °	39.394166 °	
			-121.990170 °	-122.000998 °	
DWR ID	DWR_LD0003_01_s_2012_53				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	0.13	Rating **	M	Issue No.	39
LM End	0.13	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.385713 °	39.385713 °	
			-121.989812 °	-121.989812 °	
DWR ID	DWR_LD0003_01_s_2019_39				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	0.27	Rating **	C	Issue No.	105
LM End	0.27	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.387413 °	39.387413 °	
			-121.991086 °	-121.991086 °	
DWR ID	DWR_LD0003_01_f_2016_105				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	0.50	Rating **	M	Issue No.	40
LM End	0.50	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.389241 °	39.389241 °	
			-121.994488 °	-121.994488 °	
DWR ID	DWR_LD0003_01_s _ 2019_40				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	0.56	Rating **	M	Issue No.	23
LM End	0.63	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.389390 °	39.389219 °	
			-121.995539 °	-121.996854 °	
DWR ID	DWR_LD0003_01_s _ 2012_23				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

LM Start	0.69	Rating **	M	Issue No.	55
LM End	0.69	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.388716 °	39.388716 °	
			-121.997774 °	-121.997774 °	
DWR ID	DWR_LD0003_01_s _ 2014_55				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_55_20190319_00026.jpg



View of the rodent activity along the waterside slope.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	0.71	Rating **	U	Issue No.	3
LM End	0.77	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.388578 °	39.388410 °
				-121.997987 °	-121.998992 °
DWR ID	DWR_LD0003_01_s_2012_3				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_3_20190319_00001.jpg



View of squirrel holes along the landside slope.

LM Start	0.73	Rating **	M	Issue No.	47
LM End	0.73	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.388366 °	39.388366 °
				-121.998357 °	-121.998357 °
DWR ID	DWR_LD0003_01_s_2019_47				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	0.81	Rating **	U	Issue No.	51
LM End	0.91	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.388690 °	39.389867 °
				-121.999820 °	-122.000585 °
DWR ID	DWR_LD0003_01_f_2015_51				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_51_20190319_00023.jpg



View of the rodent holes along the landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	0.84	Rating **	M	Issue No.	49
LM End	0.84	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.388949 °	39.388949 °	
			-122.000182 °	-122.000182 °	
DWR ID	DWR_LD0003_01_s_2019_49				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	1.18	Rating **	M	Issue No.	50
LM End	1.18	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.393645 °	39.393645 °	
			-122.000957 °	-122.000957 °	
DWR ID	DWR_LD0003_01_s_2019_50				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	1.21	Rating **	M	Issue No.	52
LM End	1.21	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.394010 °	39.394010 °	
			-122.000977 °	-122.000977 °	
DWR ID	DWR_LD0003_01_f_2015_52				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_52_20190319_00024.jpg



View of the rodent holes along the landside slope.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	1.34	Rating **	C	Issue No.	43
LM End	1.34	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			39.395903 °	39.395903 °
				-122.001490 °	-122.001490 °
DWR ID	DWR_LD0003_01_s_2018_43				
Comment Code					
TR : Tree or limb					
Inspector Comment					
Remove the tree from the slope and toe.					

No Photos

LM Start	1.75	Rating **	U	Issue No.	104
LM End	1.98	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.401795 °	39.405018 °
				-122.002084 °	-122.001672 °
DWR ID	DWR_LD0003_01_f_2016_104				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_104_20190319_00056.jpg



View of the rodent holes along the landside slope.

LM Start	1.78	Rating **	M	Issue No.	8
LM End	2.14	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.402225 °	39.406402 °
				-122.002053 °	-121.999907 °
DWR ID	DWR_LD0003_01_s_2019_8				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_8_20190322_00100.jpg



View of the vegetation on the landside slope, facing upstream.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	1.79	Rating **	M	Issue No.	58
LM End	2.15	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.402281 °	39.406420 °
				-122.002038 °	-121.999787 °
DWR ID	DWR_LD0003_01_s_2019_58				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_58_20190322_00101.jpg



View of the vegetation on the waterside slope, facing upstream.

LM Start	1.83	Rating **	U	Issue No.	103
LM End	2.35	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.402851 °	39.406414 °
				-122.001958 °	-121.995993 °
DWR ID	DWR_LD0003_01_f_2016_103				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_103_20190319_00055.jpg



View of the rodent holes along the waterside slope.

LM Start	2.16	Rating **	M	Issue No.	59
LM End	2.16	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.406443 °	39.406443 °
				-121.999634 °	-121.999634 °
DWR ID	DWR_LD0003_01_s_2019_59				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Clear brush from WS slope and toe.					

Photo 1 of 1 : SP_2019_LD0003_27_59_20190322_00102.jpg

View of the wild growth along the waterside slope and toe, facing north.
(Spring 2019)

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	2.16	Rating **	M	Issue No.	72
LM End	5.67	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.406463 °	39.449896 °
				-121.999538 °	-121.992011 °
DWR ID	DWR_LD0003_01_s _ 2019_72				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.18	Rating **	M	Issue No.	87
LM End	5.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.406495 °	39.449914 °
				-121.999167 °	-121.992012 °
DWR ID	DWR_LD0003_01_s _ 2019_87				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	2.35	Rating **	M	Issue No.	13
LM End	2.52	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.406413 °	39.407248 °
				-121.995993 °	-121.993177 °
DWR ID	DWR_LD0003_01_s _ 2012_13				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_13_20190319_00008.jpg



View of the rodent holes along the waterside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	2.71	Rating **	M	Issue No.	90
LM End	2.71	Issue Type +	Ma	Location *	CR
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Crown Surface / Depressions / Rutting			39.409149 °	39.409149 °
				-121.990698 °	-121.990698 °
DWR ID	DWR_LD0003_01_s_2019_90				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	3.39	Rating **	M	Issue No.	9
LM End	3.39	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.418382 °	39.418382 °
				-121.992480 °	-121.992480 °
DWR ID	DWR_LD0003_01_s_2012_9				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair the erosion along the landside slope and prevent vehicle access.					

Photo 1 of 1 : SP_2019_LD0003_27_9_20190319_00006.jpg



View of the vehicle erosion along the landside slope.

LM Start	3.54	Rating **	M	Issue No.	101
LM End	3.54	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.420537 °	39.420537 °
				-121.992206 °	-121.992206 °
DWR ID	DWR_LD0003_01_f_2016_101				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	3.76	Rating **	M	Issue No.	19
LM End	3.76	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.423747 °	39.423747 °
				-121.991667 °	-121.991667 °
DWR ID	DWR_LD0003_01_s_2012_19				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_19_20190319_00010.jpg



View of the vehicle erosion along the landside slope.

LM Start	3.90	Rating **	M	Issue No.	99
LM End	3.90	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.425481 °	39.425481 °
				-121.990204 °	-121.990204 °
DWR ID	DWR_LD0003_01_s_2019_99				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

LM Start	4.63	Rating **	U	Issue No.	64
LM End	4.68	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.435205 °	39.435855 °
				-121.988097 °	-121.988252 °
DWR ID	DWR_LD0003_01_f_2013_64				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_64_20190319_00031.jpg



View of the rodent activity along the landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain			

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	4.68	Rating **	M	Issue No.	2
LM End	4.68	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.435907 °	39.435907 °
				-121.988242 °	-121.988242 °
DWR ID	DWR_LD0003_01_f_2013_2				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Tire ruts on both sides of the levee.					

No Photos

LM Start	5.06	Rating **	U	Issue No.	21
LM End	5.25	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.441128 °	39.443793 °
				-121.990475 °	-121.991297 °
DWR ID	DWR_LD0003_01_f_2015_21				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_21_20190319_00011.jpg



View of the rodent holes along the landside slope.

LM Start	5.12	Rating **	M	Issue No.	100
LM End	5.12	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.441895 °	39.441895 °
				-121.990768 °	-121.990768 °
DWR ID	DWR_LD0003_01_s_2019_100				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove brush from WS toe.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	5.38	Rating **	U	Issue No.	70
LM End	5.39	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.445619 °	39.445808 °
				-121.991510 °	-121.991552 °
DWR ID	DWR_LD0003_01_f_2015_70				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_70_20190319_00037.jpg



View of the rodent holes along the landside slope.

LM Start	5.53	Rating **	M	Issue No.	102
LM End	5.53	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.447834 °	39.447834 °
				-121.991757 °	-121.991757 °
DWR ID	DWR_LD0003_01_s_2019_102				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove tree from LS slope.					

No Photos

LM Start	5.53	Rating **	U	Issue No.	62
LM End	5.62	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.447900 °	39.449115 °
				-121.991748 °	-121.991873 °
DWR ID	DWR_LD0003_01_f_2013_62				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_62_20190319_00029.jpg



View of the rodent holes along the landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable		N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	5.57	Rating **	M	Issue No.	107
LM End	5.57	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.448461 °	39.448461 °	
			-121.991829 °	-121.991829 °	
DWR ID	DWR_LD0003_01_s_2019_107				
Comment Code					
C3 : Add appropriate gravel or road base. Grade and compact.					
Inspector Comment					

No Photos

LM Start	5.99	Rating **	M	Issue No.	109
LM End	5.99	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.454395 °	39.454395 °	
			-121.993470 °	-121.993470 °	
DWR ID	DWR_LD0003_01_s_2019_109				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	6.06	Rating **	M	Issue No.	71
LM End	6.06	Issue Type +	Ma	Location *	LS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Animal Control		39.455313 °	39.455313 °	
			-121.993712 °	-121.993712 °	
DWR ID	DWR_LD0003_01_f_2015_71				
Comment Code					
A3 : No rodents visible, but rodent burrows visible; need to backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_71_20190319_00038.jpg



View of the rodent holes along the landside slope.

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable N : Not Inspected/Rated M : Minimally Acceptable C : Corrected U : Unacceptable A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement	
--	--	---	--	---	--

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	6.24	Rating **	M	Issue No.	7
LM End	6.38	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.457968 °	39.459955 °
				-121.993712 °	-121.993512 °
DWR ID	DWR_LD0003_01_s_2012_7				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_7_20190319_00005.jpg



Trim the trees 5 feet for better visibility.

LM Start	6.25	Rating **	M	Issue No.	111
LM End	6.76	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.458032 °	39.465107 °
				-121.993765 °	-121.991546 °
DWR ID	DWR_LD0003_01_s_2019_111				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

LM Start	6.25	Rating **	M	Issue No.	112
LM End	7.34	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.458038 °	39.473514 °
				-121.993747 °	-121.991259 °
DWR ID	DWR_LD0003_01_s_2019_112				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	6.29	Rating **	M	Issue No.	48
LM End	6.38	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.458587 °	39.459912 °
				-121.993777 °	-121.993592 °
DWR ID	DWR_LD0003_01_s_2012_48				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_48_20190319_00022.jpg



Trim trees 5 feet above ground for better visibility.

LM Start	6.50	Rating **	M	Issue No.	84
LM End	6.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.461610 °	39.461610 °
				-121.992950 °	-121.992950 °
DWR ID	DWR_LD0003_01_s_2016_84				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

LM Start	6.54	Rating **	M	Issue No.	114
LM End	6.54	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.462173 °	39.462173 °
				-121.992847 °	-121.992847 °
DWR ID	DWR_LD0003_01_s_2019_114				
Comment Code					
T2 : Thin trees to allow visibility of the ground and room to flood fight.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	6.55	Rating **	C	Issue No.	98
LM End	6.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.462275 °	39.462275 °
				-121.992825 °	-121.992825 °
DWR ID	DWR_LD0003_01_f_2016_98				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

LM Start	6.57	Rating **	M	Issue No.	34
LM End	6.57	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.462505 °	39.462505 °
				-121.992698 °	-121.992698 °
DWR ID	DWR_LD0003_01_s_2012_34				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_34_20190319_00015.jpg



View of slope instability caused by vehicle traffic.

LM Start	6.61	Rating **	U	Issue No.	76
LM End	6.61	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.463185 °	39.463185 °
				-121.992657 °	-121.992657 °
DWR ID	DWR_LD0003_01_s_2019_76				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					
Repair the burned out stump hole along the landside toe.					

Photo 1 of 1 : SP_2019_LD0003_27_76_20190319_00042.jpg



View of the burned out stump hole along the landside toe.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	6.71	Rating **	M	Issue No.	54
LM End	6.71	Issue Type +	Ma	Location *	CR
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Crown Surface / Depressions / Rutting		39.464454 °	39.464454 °	
			-121.991915 °	-121.991915 °	
DWR ID	DWR_LD0003_01_s_2019_54				
Comment Code					
C2 : Repair depressions or ruts in the crown or slope.					
Inspector Comment					

No Photos

LM Start	6.71	Rating **	M	Issue No.	45
LM End	6.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Trim / Thin Trees		39.464465 °	39.464465 °	
			-121.991938 °	-121.991938 °	
DWR ID	DWR_LD0003_01_s_2019_45				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

No Photos

LM Start	6.72	Rating **	M	Issue No.	97
LM End	6.72	Issue Type +	Ma	Location *	WS
Category	Earthen Levee		GPS Latitude/Longitude		
			Start	End	
Item	Slope Stability		39.464653 °	39.464653 °	
			-121.991789 °	-121.991789 °	
DWR ID	DWR_LD0003_01_f_2016_97				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair the vehicle ruts on the waterside slope.					

Photo 1 of 1 : SP_2019_LD0003_27_97_20190319_00054.jpg



View of the vehicle ruts on the waterside slope.

* Location	** Rating	+ Issue Type
LS : Land Side WS : Water Side CR : Crown	A : Acceptable M : Minimally Acceptable U : Unacceptable	Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	6.75	Rating **	M	Issue No.	35
LM End	6.75	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.465013 °	39.465013 °
				-121.991455 °	-121.991455 °
DWR ID	DWR_LD0003_01_s_2012_35				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_35_20190319_00016.jpg



View of the trees that are hanging over the landside slope of the levee.

LM Start	7.21	Rating **	M	Issue No.	14
LM End	7.21	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.471658 °	39.471658 °
				-121.991245 °	-121.991245 °
DWR ID	DWR_LD0003_01_s_2012_14				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_14_20190322_00105.jpg



View of the erosion caused by vehicle traffic along the landside slope and crown, facing upstream. (Spring 2019)

LM Start	7.79	Rating **	M	Issue No.	118
LM End	8.19	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.479809 °	39.485471 °
				-121.989916 °	-121.988077 °
DWR ID	DWR_LD0003_01_s_2019_118				
Comment Code					
V1 : Control annual grass and weeds on the levee slopes and easements.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	8.40	Rating **	M	Issue No.	120
LM End	8.40	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.488423 °	39.488423 °
				-121.988727 °	-121.988727 °
DWR ID	DWR_LD0003_01_s_2019_120				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_120_20190322_00109.jpg



View of the waterside slope damage caused by vehicle traffic, facing upstream. (Spring 2019)

LM Start	8.40	Rating **	U	Issue No.	119
LM End	8.40	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			39.488427 °	39.488427 °
				-121.988732 °	-121.988732 °
DWR ID	DWR_LD0003_01_s_2019_119				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					
Repair the erosion site and address the rodent activity.					

Photo 1 of 1 : SP_2019_LD0003_27_119_20190322_00108.jpg



View of the erosion caused by water runoff and rodent holes on the landside slope, facing east. (Spring 2019)

LM Start	8.87	Rating **	M	Issue No.	122
LM End	8.87	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.494481 °	39.494481 °
				-121.990027 °	-121.990027 °
DWR ID	DWR_LD0003_01_s_2019_122				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	9.50	Rating **	U	Issue No.	125
LM End	9.50	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.502635 °	39.502635 °
				-121.985245 °	-121.985245 °
DWR ID	DWR_LD0003_01_s_2019_125				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_125_20190322_00111.jpg



View of the rodent holes along the landside slope, facing downstream.
(Spring 2019)

LM Start	9.61	Rating **	A/W	Issue No.	56
LM End	9.77	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 Storm Damage		39.504388 °	39.508117 °	
			-121.985301 °	-121.986562 °	
DWR ID	DWR_LD0003_01_f_2017_56				
Comment Code					
Inspector Comment					
Levee Evaluation Comments					
Description:					
Site ID No:17					
Site Designation:DWR_LD0003_01_s_2012_52					
Repair Type: Erosion					
Rating:Serious					
Field Date:6/7/2017					
Notes: Highly vegetated levee slope. About 30' drop erosion scarp.					
From levee crest, erosion exists about 150' out towards the river.					

No Photos

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown		** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain		+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	--	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	9.61	Rating **	A/W	Issue No.	106
LM End	9.88	Issue Type +	Ma	Location *	WS
Category	Supplemental			GPS Latitude/Longitude	
				Start	End
Item	2017 USACE Erosion Survey, DRAFT			39.508117 °	39.504388 °
				-121.986562 °	-121.985301 °
DWR ID	DWR_ST0010_02_f_2022_5				
Comment Code					
Inspector Comment					
2017 Site ID: SAC 172.0 L					
Status: Critical					
2017 Field Notes: Significant erosion in last year. Erosion is entering levee prism, at current erosion rate, one more large storm and the levee will be comprised. Upgraded to critical.					
Site History: 2007 - Getting close to the levee. Bank is clayey silt with clayey/silty toe. 2008 - Looks a little worse at the upstream end. 2009 - Some new erosion and slumping. 2010 - Some new erosion upstream of site, actively eroding at low flow. New bank swallow colony noted. 2011 - Significant erosion since last year, with an estimated 10 to 15 feet of berm lost. Large sections of the bank have slumped off. 2012 - Part of the site appears to be stabilizing, but still minor slumping in other locations. 2013 - Minor new erosion at toe.					

Photo 1 of 3 : SP_2019_LD0003_27_106_20190319_00058.jpg



USACE 2013 Photo #1

LM Start	9.61	Rating **	A/W	Issue No.	106 (cont)
LM End	9.88	Issue Type +	Ma	Location *	WS

Photo 2 of 3 : SP_2019_LD0003_27_106_20190319_00059.jpg



USACE 2013 Photo #2

* Location LS : Land Side N/A : Not Applicable WS : Water Side CR : Crown	** Rating A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	+ Issue Type Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	9.94	Rating **	M	Issue No.	93
LM End	10.03	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.508912 °	39.510199 °
				-121.983989 °	-121.983912 °
DWR ID	DWR_LD0003_01_f_2016_93				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_93_20190319_00050.jpg



View of the rodent holes along the waterside slope.

LM Start	10.11	Rating **	M	Issue No.	129
LM End	10.11	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Erosion / Bank Caving			39.511429 °	39.511429 °
				-121.983983 °	-121.983983 °
DWR ID	DWR_LD0003_01_s_2019_129				
Comment Code					
E2 : Schedule repair of erosion site prior to the next inspection.					
Inspector Comment					

No Photos

LM Start	10.13	Rating **	M	Issue No.	86
LM End	10.18	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.511614 °	39.512036 °
				-121.983905 °	-121.983042 °
DWR ID	DWR_LD0003_01_s_2019_86				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	10.22	Rating **	N	Issue No.	92
LM End	10.22	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.512287 °	39.512287 °
				-121.982410 °	-121.982410 °
DWR ID	DWR_LD0003_01_f_2016_92				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

LM Start	10.50	Rating **	C	Issue No.	29
LM End	10.50	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.515342 °	39.515342 °
				-121.979202 °	-121.979202 °
DWR ID	DWR_LD0003_01_s_2012_29				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

LM Start	10.66	Rating **	U	Issue No.	89
LM End	10.66	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.517553 °	39.517553 °
				-121.979132 °	-121.979132 °
DWR ID	DWR_LD0003_01_f_2016_89				
Comment Code					
S1 : Repair slope instability.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_89_20190319_00049.jpg



View of a hole along the waterside slope that need to be backfilled and compacted.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	10.67	Rating **	C	Issue No.	30
LM End	10.67	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.517715 °	39.517715 °
				-121.979155 °	-121.979155 °
DWR ID	DWR_LD0003_01_f_2016_30				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

LM Start	10.81	Rating **	C	Issue No.	82
LM End	10.81	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.519727 °	39.519727 °
				-121.978362 °	-121.978362 °
DWR ID	DWR_LD0003_01_f_2015_82				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					

No Photos

LM Start	10.86	Rating **	M	Issue No.	81
LM End	10.96	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			39.520445 °	39.521788 °
				-121.978273 °	-121.978923 °
DWR ID	DWR_LD0003_01_f_2018_81				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the vegetation from the landside slope.					

Photo 1 of 1 : SP_2019_LD0003_27_81_20190319_00046.jpg



View of the vegetation along the landside slope.

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	10.87	Rating **	M	Issue No.	83
LM End	10.87	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.520512 °	39.520512 °
				-121.978330 °	-121.978330 °
DWR ID	DWR_LD0003_01_f_2018_83				
Comment Code					
T1 : Trim trees to at least five feet above ground level.					
Inspector Comment					
Remove the tree if diameter at chest height it 4-inches or less.					

Photo 1 of 1 : SP_2019_LD0003_27_83_20190319_00047.jpg



Remove or trim the tree on the landside slope.

LM Start	11.02	Rating **	N	Issue No.	80
LM End	11.02	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Trim / Thin Trees			39.522583 °	39.522583 °
				-121.979249 °	-121.979249 °
DWR ID	DWR_LD0003_01_f_2016_80				
Comment Code					
T5 : Tree stumps.					
Inspector Comment					
Two tree stumps are on the landside toe.					

No Photos

LM Start	11.04	Rating **	M	Issue No.	5	
LM End	11.04	Issue Type +	Ma	Location *	LS	
Category	Earthen Levee			GPS Latitude/Longitude		
				Start	End	
Item	Trim / Thin Trees			39.522873 °	39.522873 °	
				-121.979176 °	-121.979176 °	
DWR ID	DWR_LD0003_01_s_2019_5					
Comment Code						
T3 : Trim and thin trees to allow visibility of the ground and room to flood fight.						
Inspector Comment						
Remove the tree from LS slope/shoulder.						

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	

**Flood Control Project Maintenance
Levee Inspections**

Maintenance Issue Types Only, Levee Inspection Report By Mile - Spring 2019

Levee District No. 0003 (Glenn County)

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 Glenn County Sacramento River	Left	11.97	03/21/2019 03/21/2019	Makar Sokol

LM Start	11.04	Rating **	M	Issue No.	6
LM End	11.04	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			39.522921 °	39.522921 °
				-121.979172 °	-121.979172 °
DWR ID	DWR_LD0003_01_f_2012_6				
Comment Code					
S1 : Repair slope instability.					
Inspector Comment					

Photo 1 of 1 : SP_2019_LD0003_27_6_20190319_00004.jpg



View of the vertical cut along the waterside toe.

LM Start	11.41	Rating **	U	Issue No.	79
LM End	11.41	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.526822 °	39.526822 °
				-121.974562 °	-121.974562 °
DWR ID	DWR_LD0003_01_f_2018_79				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					
Repair the rodent holes along the landside slope.					

Photo 1 of 1 : SP_2019_LD0003_27_79_20190319_00045.jpg



View of the rodent holes along the landside slope.

LM Start	11.46	Rating **	M	Issue No.	130
LM End	11.46	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Animal Control			39.527428 °	39.527428 °
				-121.974107 °	-121.974107 °
DWR ID	DWR_LD0003_01_s_2019_130				
Comment Code					
A1 : Exterminate rodents and backfill and compact or grout burrows.					
Inspector Comment					

No Photos

* Location		** Rating		+ Issue Type	
LS : Land Side	N/A : Not Applicable	A : Acceptable	N : Not Inspected/Rated	Ma : Maintenance Deficiency	
WS : Water Side		M : Minimally Acceptable	C : Corrected	Ob : Design & System Obsolescence	
CR : Crown		U : Unacceptable	A/W : Acceptable but Monitor & Maintain	En : Enforcement	